

 Report No. :
 HL10238A/2016

 Page No. :
 1
 of
 5

 Date :
 FEB. 24, 2016

SUPER SHENG ENTERPRISE CO., LTD.

No. 6, Lane 151, Minsheng St., Sanhsia Dist., New Taipei City, Taiwan 23741

The following merchandise was submitted and identified by the applicant as:

Product Description:	Bracket For Gas Spring	
Style/Item No.:	BKT-10-I/O, BKT-11, BKT-11A, BKT-B11, BKT-12, BKT-12A, BKT-B12,	
	BKT-21-I/O	
Manufacturer/Vendor:	SUPER SHENG ENTERPRISE CO., LTD.	
Country of Origin:	Taiwan	
Additional information:	Bolt Stud Material: Carbon Steel; Plate Material: P-O	

We have tested the sub	omitted sample(s) as requested and the following results were obtained:
Test Requested:	Pulling test
Test Methods:	1. Fix the sample on the platform and hook a steel cable on the outer edge of protruding shaft.
	2. Apply an upward loading force in the axis of the protruding shaft by means of
	testing machine, until it is damaged then record the max. force.
	3. Testing Machine: INSTRON 5581; Speed: 10 mm/min.
	4. Diameter of steel cable: Ø 3.0 mm
Test Results:	See following sheet(s)
Date of Receipt:	Jan. 18, 2016
Testing Period:	Jan. 18, 2016 ~ Jan. 30, 2016

Signed for and on beha SGS Taiwan Ltd. Jackson Chen

Jackson Chen Team Leader

This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-enDocument.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of client's instruction, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced, except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested

 SGS Taiwan Ltd.
 N

 台灣檢驗科技股份有限公司
 t

No.127, Wu Kung Road, New Taipei Industrial Park, New Taipei City, Taiwan /新北市新北產業園區五工路 127 號 t (886-2) 2299-3279 f (886-2) 2299-2920 www.tw.sgs.com




Tes

Report No. : HL10238A/2016 Page No. : 2 of 5

est Results:		
Sample	Max. force (kgf)	Result
BKT-11A	422.5	The sample was damaged after testing. (As shown in photo I)
BKT-11	196.0	The sample was damaged after testing. (As shown in photo J)
BKT-B11	290.6	The sample was damaged after testing. (As shown in photo K)
BKT-10-I/O	310.6	The sample was damaged after testing. (As shown in photo L)
BKT-21-I/O	308.2	The sample was damaged after testing. (As shown in photo M)
BKT-12	195.7	The sample was damaged after testing. (As shown in photo N)
BKT-12A	448.2	The sample was damaged after testing. (As shown in photo O)
BKT-B12	468.4	The sample was damaged after testing. (As shown in photo P)

- Picture(s) -

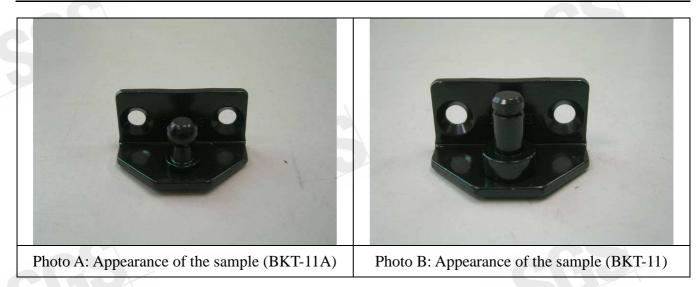



SGS Taiwan Ltd. 台灣檢驗科技股份有限公司

No.127, Wu Kung Road, New Taipei Industrial Park, New Taipei City, Taiwan /新北市新北產業園區五工路 127 號 t (886-2) 2299-3279 f (886-2) 2299-2920 www.tw.sgs.com



Report No. : HL10238A/2016 Page No. : 3 of 5

Mechanical & Hardgoods Laboratory




This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the ime of its intervention only and within the limits of client's instruction, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced, except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested

No.127, Wu Kung Road, New Taipei Industrial Park, New Taipei City, Taiwan /新北市新北產業園區五工路 127 號 t (886-2) 2299-3279 f (886-2) 2299-2920 www.tw.sgs.com



Report No. : HL10238A/2016 Page No. : 4 of 5

Mechanical & Hardgoods Laboratory

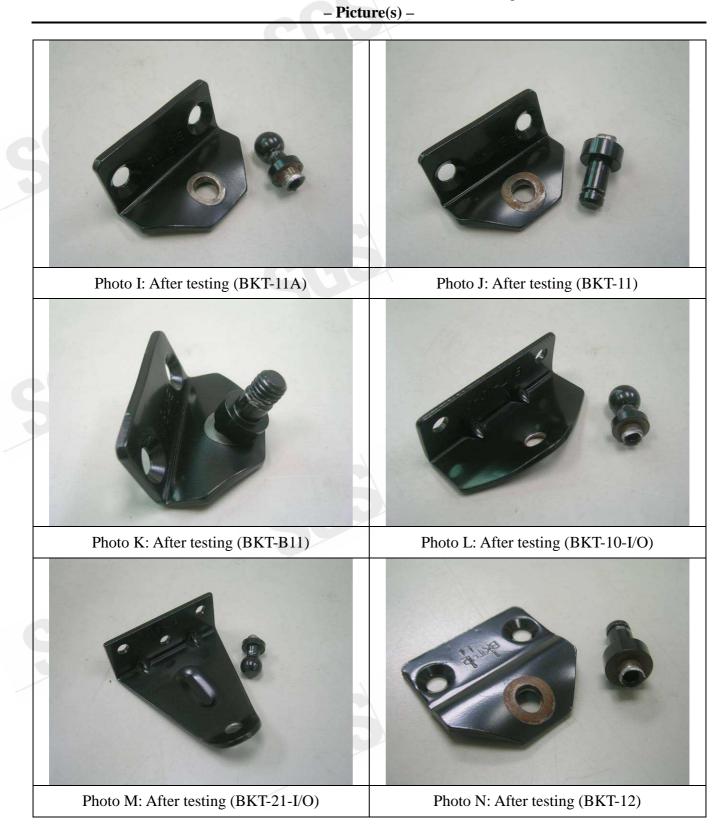

This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <u>http://www.sgs.com/en/Terms-and-Conditions.aspx</u>, Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of client's instruction, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced, except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested

No.127, Wu Kung Road, New Taipei Industrial Park, New Taipei City, Taiwan /新北市新北產業園區五工路 127 號 t (886-2) 2299-3279 f (886-2) 2299-2920 www.tw.sgs.com



Report No. : HL10238A/2016 Page No. : 5 of 5

- Picture(s) -



---End of Report---

This document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at http://www.sgs.com/en/Terms-and-Conditions.aspx This document is issued by the Company subject to its General Conditions of Service printed overlear, available on request or accessible at http://www.sgs.com/en/lerms-and-Conditions.aspx and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at http://www.sgs.com/en/lerms-and-Conditions.aspx the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of client's instruction, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced, except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested SGS Taiwan Ltd. No.127, Wu Kung Road, New Taipei Industrial Park, New Taipei City, Taiwan /新北市新北產業園區五工路 127 號

t (886-2) 2299-3279 f (886-2) 2299-2920 www.tw.sgs.com